


Pinless Moisture/Humidity Meter + IR

Model MO290

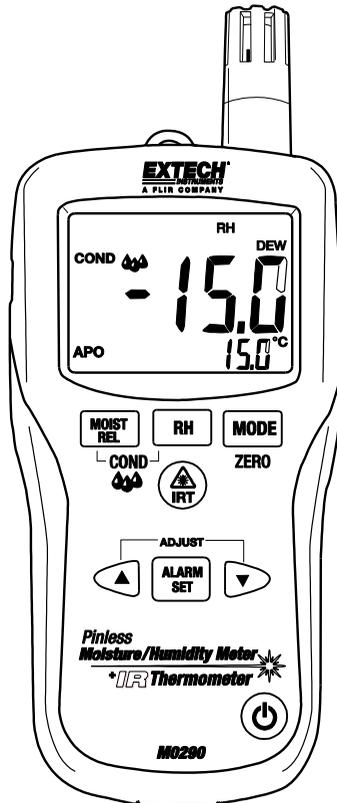


Introduction

Thank you for selecting the Extech Instruments Model MO290. This device is shipped fully tested and calibrated and, with proper use, will provide years of reliable service. Please visit our website (www.extech.com) to check for the latest version of this User Guide, Product Updates, and Customer Support.


Meter Description

1. IR temperature sensor
2. Laser pointer
3. Humidity sensor
4. Temperature sensor
5. LCD display
6. Relative Humidity button
7. Mode/Zero Button
8. IR thermometer button
9. Alarm set button
10. Alarm adjust down button
11. ON/OFF power button
12. Remote pin probe input jack (bottom)
13. Battery compartment (rear)
14. Alarm adjust up button
15. Moisture/Relative button
16. Protective cap

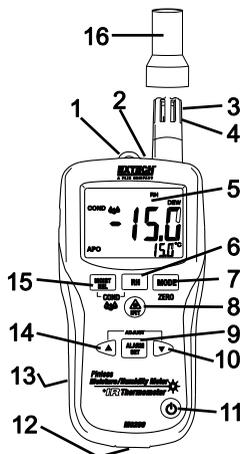

LCD Display

1. MIN MAX – Minimum and maximum value
2. HIGH LOW – Alarm limits
3. INT EXT – Internal/External probe
4. mBar – Vapor pressure
5. kPa – Vapor pressure
6. GPP – Grains per Pound
7. g/kg – Grains per kilogram
8. MOIST – Moisture mode
9. RH% - Relative Humidity mode
10. COND – Condensation mode
11. APO – Auto power off
12. DEW – Dew Point temperature
13. C/F – Temperature units
14.  - Low battery
15.  - Laser pointer On

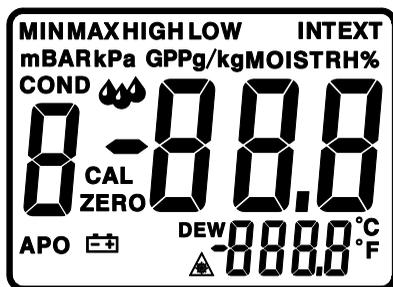

Safety

- Use extreme caution when the laser pointer beam is on
- Do not point the beam toward anyone's eye or allow the beam to strike the eye from a reflective surface
- Do not use the laser near explosive gases or in other potentially explosive areas



Cautions

- This device is not a toy and must not reach children's hands. It contains hazardous objects as well as small parts that the children could swallow. In case a child swallows any of them, please contact a physician immediately
- Do not leave the battery and packing material lying around unattended; they can be dangerous for children if they use them as toys
- In case the device is going to be unused for an extended period of time, remove the battery to prevent them from draining
- Expired or damaged batteries can cause cauterization on contact with the skin. Always, use suitable hand gloves in such cases
- See that the battery is not short-circuited. Do not throw the battery into a fire.

Battery Replacement

1. Turn off the meter.
2. Remove one Philips head screw and lift off the rear battery cover.
3. Replace the 9V battery.
4. Secure the rear battery cover.

Operation

Powering the meter

1. Remove the RH sensor protective cap before use.
2. Press the power  button to turn the meter on.
3. If the  symbol appears or the meter does not turn on, replace the battery.

Humidity (Dew point, GPP, g/kg) Measurements

1. Press the power  button to turn the meter on.
2. Press the RH button
3. Relative Humidity will be displayed in the primary display and the temperature will be displayed in the secondary display.
4. Press the up or down arrow button to change the temperature units.
5. Press the MODE button to display the DEW point.
6. Press the MODE button to display GPP (°F) or g/kg (°C)

Pinless Moisture Measurements (Zero set)

1. Press the power  button to turn the meter on.
2. Press the MOIST button to select Moisture measurement." MOIST" and "INT" (internal pinless sensor) will appear in the display.
3. **Zero the meter:** Hold the meter so that the rear sensor is away from any surface or your hand. The reading should be near 0.0. If not, press and hold the **ZERO** button for more than 2 second and the **ZERO** icon appears.
4. Place the rear sensor on the surface of the material to be tested and read the relative moisture content.

Pin Type Moisture Measurements

1. Connect the external pin probe to the jack on the bottom of the meter.
2. Press the power  button to turn the meter on.
3. Press the MOIST button twice to select Moisture measurement." MOIST" and "EXT" (external pin probe) will appear in the display.
4. Press the probe pins into the material and read the % moisture content in the display.

Auto Power Off

The meter will enter a sleep mode after 30 minutes of inactivity. The meter will emit a warning beep 15 seconds before shutting down.

To disable the APO feature, press the MODE button when turning the meter ON. The "APO" icon will not appear, indicating it is disabled.

Infrared Temperature Measurements

1. Press the power  button to turn the meter on.
2. Press the IRT button to enable the IR thermometer and the laser pointer. The laser pointer icon will flash while the mode is active.
3. Aim the laser pointer at the surface to be measured and read the surface temperature in the secondary display.
4. Release the IRT button. The last temperature measured and the laser icon will remain on the display for approximately 10 seconds before returning to ambient temperature measurement.


IRT MAX MIN display:

The meter can be set to display only the maximum or minimum temperature measured during an IR scan.

1. With the meter in the IR hold mode, press the MODE button. "MIN" will appear in the display.
2. Press the IRT button to enable the IR thermometer. The meter will display the minimum temperature measured and will update only when a lower temperature is measured.
3. Press the MODE button twice to enable the MAX mode and proceed as stated above for the maximum temperature.
4. The MAX or MIN temperature is not stored when the function is exited.

IR Field of View

Ensure that the desired target is larger than the spot size. As the distance from an object increases, the spot size of the area measured by the meter becomes larger. The meter's field of view ratio is 8:1, meaning that if the meter is 8 inches (cm) from the target, the diameter (spot) of the object under test must be at least 1 inch (cm). Refer below to the field of view diagram.

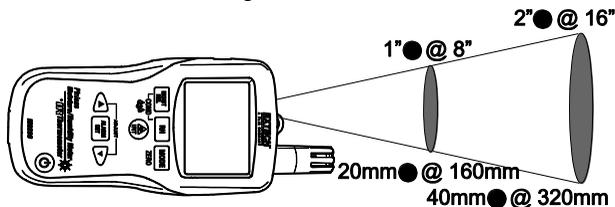

WARNING: Do not directly view or direct the laser pointer at an eye. Low power visible lasers do not normally present a hazard, but may present some potential for hazard if viewed directly for extended periods of time.



Condensation Mode

The Condensation feature alerts the user when the surface temperature as measured by the IR thermometer is close to or has reached the Dew Point temperature.

1. Press the power  button to turn the meter on.
2. Simultaneously press the MOIST/REL and RH buttons. The “COND” icon will appear.
3. Point the meter at a surface, press the IRT button to measure the surface temperature. The small display will indicate the IR surface temperature and the large display will indicate the difference between the IR temperature and the Dew Point temperature.
4. The meter will then report the potential for condensation on that surface in the following manner
 - If the temperature of the IRT is more than 14°C (25°F) above the Dew Point, the temperature difference shall be displayed, with no other warning.
 - If the temperature of the IRT is 3-14°C (5-25°F) above the Dew Point, the temperature difference shall be displayed, along with a standard Condensation Indicator icon. The meter shall beep once to confirm that the reading is in the risk area.
 - If the temperature of the IRT is less than 3°C (5°F) above the Dew Point, the temperature difference shall be displayed, along with a flashing Condensation Indicator icon. The meter shall beep twice to confirm that the reading is in the high-risk area.
5. Press the RH button to exit the mode.

Vapor Pressure Mode

1. With the Condensation mode active, press the MODE button to display the Vapor Pressure in mBAR (°F) or kPa (°C).
2. Press the MODE button to exit the Vapor Pressure mode.

Alarm High and Low Limit Setting

High and Low alarm points can be set for Humidity and Moisture measurements.

Humidity Alarm Set Procedure:

1. With RH% displayed, simultaneously press the RH and MODE buttons.
2. The “HIGH” icon will appear on the display.
3. Press the ▲ or ▼ button to set the high limit desired.
4. Press the ALARM SET button to save the value and proceed to the LOW set value.
5. With the “LOW” icon in the display, Press the ▲ or ▼ button to set the low limit desired.
6. Press the ALARM SET button to save the value and to return to the normal mode.
7. If the humidity measurement is lower than the low alarm setting or higher than the high alarm setting, the meter will beep once every second.

Moisture Alarm Set Procedure:

1. With MOIST displayed, simultaneously press the MOIST/REL and MODE buttons.
2. The "HIGH" icon will appear on the display.
3. Press the ▲ or ▼ button to set the high limit desired.
4. Press the ALARM SET button to save the value and proceed to the LOW set value.
5. With the "LOW" icon in the display, Press the ▲ or ▼ button to set the low limit desired.
6. Press the ALARM SET button to save the value and to return to the normal mode.
7. If the moisture measurement is higher than the LOW alarm setting, the meter will beep once every second
8. If the moisture measurement is higher than the HIGH alarm setting, the meter will beep continuously.

Change Temperature units from F to C or C to F

1. Press the power  button to turn the meter on.
2. Press the IRT button to turn on the IR thermometer and then release the button.
3. Press the ▲ or ▼ button to set the desired temperature unit

Specifications

Function	Range	Accuracy
Pinless Moisture	0 to 99.9	Relative only
External - Moisture in wood	6-99 %	± 5%
External - Moisture in building materials	13-99 %	± 5%
Pinless Depth	Up to 0.75" (19mm)	
RH Measurement	0 to 10%	± 3%RH
	11 to 90%	± 2.5%RH
	91 to 100%	± 3%RH
Air Temperature	-20 to 170°F (-29 to 77°C)	± 3.6°F (2.0°C)
IR Temp	-4 to 31°F	± 9°F
	32°F	± 2°F
	33 to 392°F	Greater of ±3.5% or ±9°F
	-20 to -1°C	± 4.5°C
	0°C	± 1°C
	1 to 200°C	Greater of ±3.5% or ± 4.5°C

Display	3-digit primary display, 4-digit secondary display
Vapor Pressure	0 to 20.0kPA
Dew Point	-22 to 199°F (-30 to 100°C)
Mixing Ratio	0-999 GPP (0 to 160g/kg)
Sample Rate	2 per second
Backlight	White LED
Operating Temperature	40 to 110°F (4 to 43°C)
Storage Temperature	-14 to 140°F (-30 to 60°C)
Operating Humidity	90%, 32-86°F (0-30°C), 75%, 86-104°F (30-40°C), 45%, 104-122°F (40-50°C)
Storage Humidity	90%
Power Supply	9V battery
Battery Life	6-8 weeks (4 hrs/day use), using alkaline batteries
Auto Power Off (APO)	After 30 minutes (nominal) inactivity. The APO function can be disabled by the user.
APO Quiescent Current	50μA maximum
Dimensions	6.5x2.8x1.5'(165x70x38mm)
Weight	7.4oz (210g)

Two-year Warranty

Teledyne FLIR warrants this Extech brand instrument to be free of defects in parts and workmanship for **two years from date of shipment (a six-month limited warranty applies to sensors and cables). To view the full warranty text please visit:**

<http://www.extech.com/support/warranties>.

Calibration and Repair Services

Teledyne FLIR offers calibration and repair services for the Extech brand products we sell. We offer NIST traceable calibration for most of our products. Contact us for information on calibration and repair availability, refer to the contact information below. Annual calibrations should be performed to verify meter performance and accuracy. Product specifications are subject to change without notice. Please visit our website for the most up-to-date product information:

www.extech.com.

Contact Customer Support

Customer Support Telephone List: <https://support.flir.com/contact>

Calibration, Repair, and Returns: repair@extech.com

Technical Support: <https://support.flir.com>

Copyright © 2023 Teledyne FLIR Commercial Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form

www.extech.com

This document does not contain any export-controlled information