


Desktop Indoor Air Quality Monitor


Model CO100

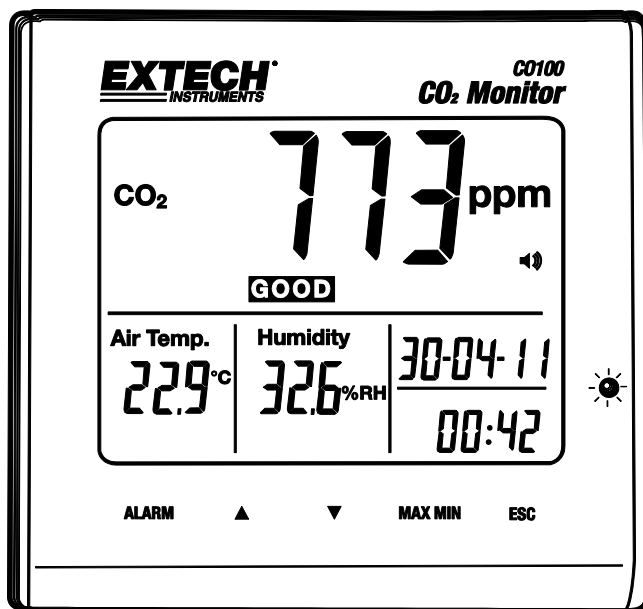

Introduction

Congratulations on your purchase of this Extech Meter. The Carbon Dioxide (CO₂) Monitor is designed for air quality control and health control by measuring Carbon Dioxide level in areas where CO₂ could be a concern. The measured CO₂ value in ppm (parts-per-million), Temperature, Humidity and Time will be displayed on the LCD along with three CO₂ status indications: Good (0 to 800ppm), Normal (800 to 1200ppm), Poor (>1200ppm). An acoustic alarm sounds when the CO₂ level exceeds a defined level. This meter is shipped fully tested and calibrated and, with proper use, will provide years of reliable service.

Operation

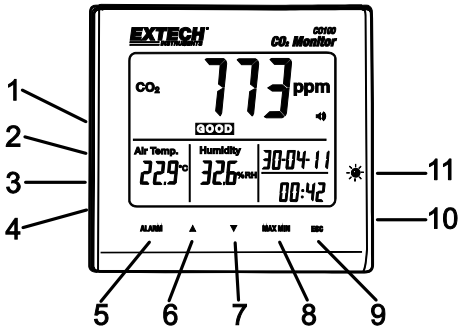1. **Power button** (rear)
Turns the unit on or off.
 2. **HOLD button** (rear)
Freezes the current reading in the display.
 3. **°C/°F button** (rear)
Selects °C or °F
 4. **Clock button** (rear)
Press and hold this button for 2 seconds to enter into clock mode. Press the “▲” or “▼” button to adjust the flashing digits. Press the clock button again to step through the settings (day:month:year;hour:minute). Press the “ESC” button to exit the clock setting mode.
- 
- The diagram shows the EXTECH CO100 CO₂ Monitor. It has a square LCD display showing CO₂ level at 773 ppm, status 'GOOD', Air Temp at 22.9°C, Humidity at 32.6%, and Time at 30-04-11. Below the display are five buttons: ALARM (5), ▲ (6), ▼ (7), MAX MIN (8), and ESC (9). To the right of the device are two more callouts: 11 pointing to a speaker icon and 10 pointing to the bottom edge of the device.
5. **Alarm button**
Press the Alarm button once to activate the Alarm mode. The speaker icon appears on LCD display. If the measured value exceeds the defined value, the alarm will sound and the display will flash. Press the button again to exit the Alarm mode.

Alarm Value Setting

Press and hold the ALARM button for 2 seconds to enter into setting mode. The speaker icon will flash.

Press the ▲ or ▼ button to increase or decrease the value.

Press the ESC button to exit the setting mode.

“GOOD-NORMAL” and “NORMAL-POOR” Value Setting

In the Alarm Value Setting mode, press the ALARM button to set the GOOD NORMAL threshold value. “GOOD NORMAL” will appear in the display. Adjust the value as needed. Press the ALARM button again to set the NORMAL POOR threshold value. “NORMAL POOR” will appear in the display. Adjust the value as needed. Press the ESC button to exit the mode.

6. **▲ button**
Press this button to increase a value. Press the “ESC” button to exit the function.
7. **▼ button**
Press this button to decrease a value. Press the ESC button to exit the function.

8. **MAX MIN button**

Press the button once, the "MAX" icon appears and the Maximum measured value of CO₂, temperature and humidity will be displayed on the screen. The display will be updated only if a higher value is measured. Press this button again, the "MIN" icon appears and the Minimum measured value of CO₂ temperature and humidity will be displayed on the screen. Press ESC button to exit the function.

9. **ESC button**

Press this button to exit the current mode.

10. AC adaptor socket

11. Power ON LED

Backlight

Touch the button area below the LCD and the backlight will turn on. It will turn off automatically after 20 seconds of inactivity. Press "ESC" button at any time to exit the function.

ABC (Automatic Baseline Calibration)

ABC (Automatic Baseline Calibration) establishes a baseline calibration to eliminate the zero drift of the infrared sensor. The ABC function is always "ON" when the meter is turned on. ABC is designed to calibrate the meter at the minimum CO₂ reading detected during 7 days of continuous monitoring (power on). It assumes that the area being tested receives fresh air with a CO₂ level of approximately 400ppm at some period of time during the seven days. It is not suitable to use a desktop CO₂ meter in closed areas with consistently high CO₂ levels, 24 hours a day.

Maintenance

1. The meter should be cleaned with a damp cloth and mild detergent when necessary. Do not use solvents or abrasives.
2. Store the meter in an area with moderate temperature and humidity.

Specifications

Function	Range	Resolution	Accuracy
CO2	0 to 9999ppm	1ppm	±75 ppm or ±5% of reading
Temperature	23 to 122°F (-5°C to 50°C)	0.1°	±1.5°C/2.7°F
Humidity	0.1 to 90.0%	0.1%	±5%

Display	LCD with backlighting
Sampling Interval:	2 seconds
Overload Indication:	“-OL-”
Sensor Type	CO2: NDIR (non-dispersive infrared) technology
Operating Conditions	-5°C to 50 °C (23 oF to 122 oF) at < 90 % RH
Storage Conditions	-5°C to 50 °C (23 oF to 122 oF) at < 90 % RH
Power Supply	110V~220V AC, output 6.0V DC ≥ 500mA (supplied)
Dimensions / Weight	117x102x102mm (4.6x4x4”); 204g (7.2 oz.)

Warranty

FLIR Systems, Inc. warrants this Extech Instruments brand device to be free of defects in parts and workmanship for one year from date of shipment (a six month limited warranty applies to sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department for authorization. Visit the website www.extech.com for contact information. A Return Authorization (RA) number must be issued before any product is returned. The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. FLIR Systems, Inc. specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential damages. FLIR's total liability is limited to repair or replacement of the product. The warranty set forth above is inclusive and no other warranty, whether written or oral, is expressed or implied.

Calibration, Repair, and Customer Care Services

FLIR Systems, Inc. offers repair and calibration services for the Extech Instruments products we sell. We offer NIST traceable calibration for most of our products. Contact our Customer Service Department for information on calibration service availability. Annual calibrations should be performed to verify meter performance and accuracy. Technical support and general customer service is also provided, refer to the contact information provided below.

Support Lines: U.S. (877) 239-8324; International: +1 (603) 324-7800

Technical Support: Option 3; E-mail: support@extech.com

Repair & Returns: Option 4; E-mail: repair@extech.com

Product specifications are subject to change without notice

Please visit our website for the most up-to-date information

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

ISO 9001 Certified

Copyright © 2013 - 2016 FLIR Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form

www.extech.com

Garantie

FLIR Systems, Inc. garantit que cet appareil Extech Instruments est exempt de défauts matériaux et de fabrication pendant un ans à partir de la date d'envoi (une garantie limitée de six mois s'applique aux capteurs et aux câbles). Si le renvoi de l'appareil pour réparation devient nécessaire durant ou après la période de garantie, contactez le service client pour autorisation. Pour obtenir les coordonnées, visitez le site Web suivant : www.extech.com. Un numéro d'autorisation de retour (AR) doit être délivré avant tout retour de produit. L'expéditeur prend à sa charge les frais d'expédition, le fret, l'assurance et l'emballage correct de l'appareil afin de prévenir toute détérioration durant le transport. Cette garantie ne s'applique pas aux dommages imputables à l'utilisateur, tels que l'usage impropre ou abusif, un mauvais câblage, une utilisation non conforme aux spécifications, un entretien ou une réparation incorrecte, ou toute modification non autorisée. FLIR Systems, Inc. déclinera spécifiquement toute garantie ou qualité marchande ou aptitude à l'emploi prévu, et ne sera en aucun cas tenu responsable pour tout dommage conséquent, direct, indirect ou accidentel. La responsabilité totale de FLIR est limitée à la réparation ou au remplacement du produit. La garantie définie ci-dessus est inclusive et aucune autre garantie, écrite ou orale, n'est exprimée ou implicite.

Calibrage, réparation et services après-vente

FLIR Systems, Inc. offre des services de calibrage et de réparation pour les produits Extech Instruments que nous commercialisons. Nous offrons l'étalonnage traçable NIST pour la plupart de nos produits. Contactez notre service clientèle pour obtenir des informations sur la disponibilité des services d'étalonnage. Un calibrage doit être effectué chaque année pour vérifier les performances et la précision du mètre. Nous offrons également une assistance technique et un service à la clientèle. Veuillez vous reporter aux coordonnées fournies ci-dessous.

Lignes d'assistance: États-Unis (877) 239-8324; international: +1 (603) 324-7800

Service d'assistance technique : Option 3 ; E-mail : support@extech.com

Réparations et retours : Option 4 ; E-mail : repair@extech.com

Les spécifications produit sont sujettes à modifications sans préavis.

Pour les toutes dernières informations, veuillez visiter notre site Web.

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certifié ISO 9001

Copyright © 2013 - 2016 FLIR Systems, Inc.

Tous droits réservés, y compris la reproduction partielle ou totale sous quelque forme que ce soit.

www.extech.com

Garantía

FLIR Systems, Inc., garantiza este dispositivo marca Extech Instruments para estar libre de defectos en partes o mano de obra durante **uno años** a partir de la fecha de embarque (se aplica una garantía limitada de seis meses para cables y sensores). Si fuera necesario regresar el instrumento para servicio durante o después del periodo de garantía, llame al Departamento de Servicio a Clientes para obtener autorización. Visite www.extech.com para Información de contacto. Se debe expedir un número de Autorización de Devolución (AD) antes de regresar cualquier producto. El remitente es responsable de los gastos de embarque, flete, seguro y empaque apropiado para prevenir daños en tránsito. Esta garantía no se aplica a defectos resultantes de las acciones del usuario como el mal uso, alambrado equivocado, operación fuera de las especificaciones, mantenimiento o reparación inadecuada o modificación no autorizada. FLIR Systems, Inc., rechaza específicamente cualesquier garantías implícitas o factibilidad de comercialización o idoneidad para cualquier propósito determinado y no será responsable por cualesquier daños directos, indirectos, incidentales o consecuentes. La responsabilidad total de FLIR está limitada a la reparación o reemplazo del producto. La garantía precedente es inclusiva y no hay otra garantía ya sea escrita u oral, expresa o implícita.

Servicios de calibración, reparación y atención a clientes

FLIR Systems, Inc., ofrece servicios de reparación y calibración para los productos que vendemos de Extech Instruments. Ofrecemos calibración rastreable a NIST para la mayoría de nuestros productos, para información sobre la disponibilidad del servicio de calibración por favor llame a nuestro Departamento de Servicio al Cliente.

Para verificar el funcionamiento y precisión se debe realizar la calibración anual. Además se provee Soporte Técnico y servicios generales al cliente, consulte la información de contacto en seguida.

Líneas de soporte: EE.UU. (877) 239-8324; Internacional: +1 (603) 324-7800

Soporte Técnico Opción 3; correo electrónico: support@extech.com

Reparación / Devoluciones: Opción 4; correo electrónico: repair@extech.com

Las especificaciones del producto están sujetas a cambios sin aviso

Por favor visite nuestra página en Internet para la información más actualizada

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certificado ISO 9001

Copyright © 2013 - 2016 FLIR Systems, Inc.

Reservados todos los derechos, incluyendo el derecho de reproducción total o parcial en cualquier medio

www.extech.com